

Separate Sensor Mounts (not combinable)

With slotted holes for fast adjusting and clip able designation labels.

1 Sensor Mount Ø 30 mm, with or without fixed stop „F“

| Item | Item No. | Ø |
|---------------|-------------|-------|
| SH-Quick 30 | 56 10 30 30 | 30 mm |
| SH-Quick 30-F | 56 10 20 30 | 30 mm |

Material: PA 6 GK, Screw: DIN 912, M 5 x 25 zinc plated, Nut: DIN 985, M 5 zinc plated

Combinable Sensor Mounts

With slotted holes for fast adjusting and clip able designation labels.

Combinable with mounting bracket „W“ and mounting plate „P“.

2 Sensor Mount Ø 18 mm und 12 mm, with or without fixed stop „F“

| Item | Item No. | Dim. A | Dim. B | Dim. C | Dim. D |
|---------------|-------------|---------|----------|--------|--------|
| SH-Quick 18 | 56 10 30 18 | Ø 18 mm | 12,85 mm | 12 mm | 24 mm |
| SH-Quick 18-F | 56 10 20 18 | Ø 18 mm | 12,85 mm | 12 mm | 24 mm |
| SH-Quick 12 | 56 10 30 12 | Ø 12 mm | 9,75 mm | 9 mm | 18 mm |
| SH-Quick 12-F | 56 10 20 12 | Ø 12 mm | 9,75 mm | 9 mm | 18 mm |


Material: PA 6 GK, Screw: DIN 912, M 5 x 16 accordingly M 5 x 10 zinc plated, Nut: DIN 985, M 5 zinc plated

Ready mounted Sensor Mounts

With clip able designation labels.

3 Combined with mounting plate „P“, with or without fixed stop „F“


| Item | Item No. | Dim. A | Dim. B |
|----------------|-------------|-----------|---------|
| SH-Quick 18-P | 56 10 31 18 | Ø 36,5 mm | 24,5 mm |
| SH-Quick 18-FP | 56 10 21 18 | Ø 36,5 mm | 24,5 mm |
| SH-Quick 12-P | 56 10 31 12 | Ø 30,5 mm | 21,5 mm |
| SH-Quick 12-FP | 56 10 21 12 | Ø 30,5 mm | 21,5 mm |

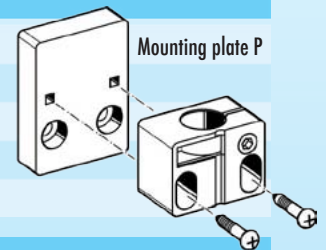

4 Combined with mounting bracket „W“, with or without fixed stop „F“

| Item | Item No. | Dim. A | Dim. B |
|----------------|-------------|--------|--------|
| SH-Quick 18-W | 56 10 32 18 | 85 mm | 58 mm |
| SH-Quick 18-FW | 56 10 22 18 | 85 mm | 58 mm |
| SH-Quick 12-W | 56 10 32 12 | 79 mm | 55 mm |
| SH-Quick 12-FW | 56 10 22 12 | 79 mm | 55 mm |

Connection screws: DIN 7981, 4,2 x 22 accordingly 4,2 x 19

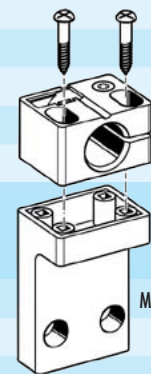

Separate base part

| Item | Item No. | Dim. A |
|--------------------|-------------|----------|
| Mounting plate P | 56 10 01 12 | Straight |
| Mounting bracket W | 56 10 02 12 | Angular |

Material: PA 6 GK

Separate Sensor Mounts (not combinable)

Compact construction method for limited space, without slotted holes and designation labels.

5 Sensor Mount Ø 8 mm to 3 mm, with or without fixed stop „F“

| Item | Item No. | Dim. A |
|--------------|-------------|----------------------------------------------|
| SH-Quick 8 | 56 05 10 80 | Ø 8 mm |
| SH-Quick 8-F | 56 05 20 80 | Ø 8 mm |
| SH-Quick 6,5 | 56 05 10 65 | Ø 6,5 mm (available only without fixed stop) |
| SH-Quick 5 | 56 05 10 50 | Ø 5 mm (available only without fixed stop) |
| SH-Quick 4 | 56 05 10 40 | Ø 4 mm (available only without fixed stop) |
| SH-Quick 3 | 56 05 10 30 | Ø 3 mm (available only without fixed stop) |

Material: PA 6 GK, Screw: DIN 912, M 3 zinc plated, Nut: DIN 934, M 3 zinc plated

SH-Quick is protected by patent.